



Service Bulletin

American Honda Motor Co., Inc.

2001 GL1800/A Speedometer Replacement

This Service Bulletin will assist you in the replacement of the speedometer unit on affected 2001 GL1800/A models.

The speedometer faceplate may warp from extended exposure to direct sunlight. This can produce intermittent sticking of the speedometer needle. A replacement speedometer is now available to correct this condition.


Only perform this procedure if the motorcycle actually experiences a sticking speedometer needle. If other instrument needles are sticking, contact TechLine at (800) 421-1900 before proceeding further.

AFFECTED UNITS

All model year 2001 GL1800/As.

REPAIR PROCEDURE

1. Remove the combination meter assembly (see page 19-14 in the Service Manual).
2. Disassemble the combination meter assembly.
NOTE: It is not necessary to remove the LCD assembly.
3. Remove the two speedometer attachment screws located on the back side of the combination meter circuit board.

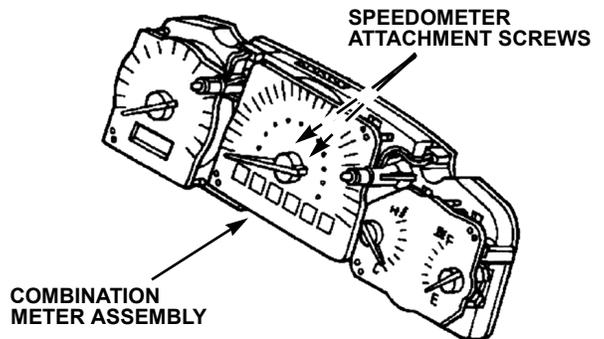

4. Remove the speedometer.
5. Install the replacement speedometer.
6. Reassemble the combination meter assembly and reinstall it in the reverse order of disassembly.

PARTS INFORMATION

Non-ABS Model

P/N: 37200-MCA-671

H/C: 6878920

ABS Model

P/N: 37200-MCA-971

H/C: 6878961

WARRANTY INFORMATION

Normal warranty applies. After completion of the repair, submit one claim per VIN using the following information only.

Non-ABS Model

Template #: **GL8A**

Flat Rate Time = **1.7 hours**

ABS Model

Template #: **GL8B**

Flat Rate Time = **1.7 hours**

CUSTOMER INFORMATION: The information in this bulletin is intended for use *only* by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your Honda. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your Honda, or that your Honda has the condition described. To determine whether this information applies, contact an authorized Honda dealer.